




Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
ALL	ALL AREAS	BROWN FIRESTOP	PIPE PENETRATION	CEILING SPACE	UNKNOWN	18297-S15A	5	CHRYSTILE	GOOD	YES	B	FRIABLE	OBSERVED TO BE PRESENT IN ROOM H216C. SAMPLED BY MAPLE IN 2019 (PROJECT #18297), AND PRESUMED TO BE PRESENT IN OTHER AREAS OF THE BUILDING. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
ALL	ALL AREAS	BEIGE CAULKING	BETWEEN DOOR FRAME AND WALL	DOOR	UNKNOWN	18297-S04A-C	1	CHRYSTILE	GOOD	SUSPECT	A	NON-FRIABLE	SAMPLED IN STAIRWELL H501S BY MAPLE (PROJECT #18297), AND PRESUMED TO BE PRESENT IN OTHER AREAS OF THE BUILDING. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
ALL	ALL AREAS	BLACK CAULKING	DOOR CAULKING - GAP BETWEEN DOOR & GLASS	DOOR	UNKNOWN	26417-1A	5	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED IN STAIRWELL H316S BY OHE (PROJECT #26417), AND PRESUMED TO BE PRESENT IN OTHER AREAS OF THE BUILDING. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
ROOF	ROOF	ROOFING MATERIALS	BLACK ROOFING MATERIALS	ROOF	UNKNOWN	S01A-C, S02A-C, S07A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #17080). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
			WHITE CAULKING	ROOF	UNKNOWN	S04A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #17080). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
			BLACK CAULKING	ROOF	UNKNOWN	S05A-C, S06A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #17080). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
			GREY CAULKING	ROOF	UNKNOWN	S03A-C	1	CHRYSTILE	GOOD	YES	C	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #17080). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H100K	CORRIDOR	CEILING TILE	2'X4' SMALL PINHOLE & LENGTHWISE FISSURES	CEILING	50 SQ. FT.					NO			SAMPLED BY OHE (PROJECT #25995) IN 2020.		4
H102	ELEVATOR ROOM	NO SUSPECT ACM OBSERVED								NO					N/A
H103	ELEVATOR LOBBY	DRYWALL	DRYWALL JOINT COMPOUND	WALL		26254-1A-C		ND		NO			SAMPLED BY OHE (PROJECT #26254) IN 2020.		N/A
		CEMENT PARGING	GREY	WALL (CEILING SPACE)		27467-1A-C		ND		NO			SAMPLED BY OHE (PROJECT #27467) IN 2022		N/A
		CEILING TILE	2'X4' SMALL PINHOLE & LENGTHWISE FISSURES	CEILING	200 SQ. FT.	25995-2B				ND			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
H103A	ELECTRICAL ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	2	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	7 FITTINGS REMOVED IN 2018 (CURMANN PROJECT #16940). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND OR HEALTH AND SAFETY		4
		CEILING TILE	2'X4' SMALL PINHOLE & LENGTHWISE FISSURES	CEILING		25995-2C				ND			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		CEILING TILE	2'X4' SMALL PINHOLE & SMALL FISSURES	CEILING		25995-3C				ND			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		CEILING TILE	2'X4' SMALL AND BIG PINHOLES	CEILING		25995-4A-C				ND			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
H103B	VACANT ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	4	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		CEILING TILE	2'X4' SMALL PINHOLE & BUMPS	CEILING		25995-1C				ND			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		CEILING TILE	2'X4' SMALL PINHOLE & SMALL FISSURES	CEILING		25995-3B				ND			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	250 SQ. FT.	25622-023-4A-C		ND		NO			SAMPLED BY OHE (PROJECT #25622-023 IN 2022)		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		26254-2A-J		ND		NO			SAMPLED BY OHE (PROJECT #26254) IN 2020.		N/A
H103C	VACANT ROOM	MASTIC	BEEHIND VINYL BASEBOARD			26254-3A-C		ND		NO			SAMPLED BY OHE (PROJECT #26254) IN 2020.		N/A
		VINYL SHEET FLOORING	GREY WITH MOSAIC PATTERN	FLOOR		26254-4A-C		ND		NO			SAMPLED BY OHE (PROJECT #26254) IN 2020.		N/A
		MASTIC	YELLOW	UNDER THRESHOLD STRIP		26254-5A-C		ND		NO			SAMPLED BY OHE (PROJECT #26254) IN 2020.		N/A
		CEILING TILE	2'X4' SMALL PINHOLE & BUMPS	CEILING		25995-1A				ND			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	250 SQ. FT.	R-SA98		SUSPECT	GOOD	SUSPECT NO	A	NON-FRIABLE	NOT OBSERVED DURING 2021 REASSESSMENT		N/A
H103D	VACANT ROOM	NEW LAY-IN CEILING TILES											NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H103E	VACANT ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	8	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	250 SQ. FT.	25622-023-5A-C		ND		NO			SAMPLED BY OHE (PROJECT #25622-023 IN 2022)		N/A
		CEILING TILE	2'X4' PINHOLE & BUMPS	CEILING		25995-1B		ND		NO			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		CEILING TILE	2'X4' PINHOLE & LONG FISSURES	CEILING		25995-2A		ND		NO			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		CEILING TILE	2'X4' PINHOLE & SMALL FISSURES	CEILING		25995-3A		ND		NO			SAMPLED BY OHE (PROJECT #25995) IN 2020.		N/A
		NEW LAY-IN CEILING TILES						ND		NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H103F	CONFIDENTIAL FILES STORAGE	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	4	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	AT ENTRANCE IN CORNER		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	250 SQ. FT.	R-SA98		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	APPEARS TO BE REMOVED, NOT OBSERVED DURING THE 2021 REASSESSMENT SURVEY		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H103G	ELEVATOR	NO SUSPECT ACM OBSERVED								NO					N/A
H103K	CORRIDOR	CEILING TILE	2'X4' SMALL PINHOLE & LENGTHWISE FISSURES	CEILING - ADJACENT TO DOOR TO ROOM H103				ND		NO	A	NON-FRIABLE	SAMPLED BY OHE (PROJECT #25995) IN 2020.		4
H104	CARETAKER LUNCHROOM	TRANSITE MATERIAL	TRANSITE COUNTER TOP	COUNTER	30 SQ. FT.	N/A	10	CHRYSTILE	GOOD	YES	A	NON-FRIABLE			4
		FLOOR TILE	12"X12" OFF WHITE FLOOR TILE	FLOORS	400 SQ. FT.	SA85	5	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	FLOOR TILES CONTAIN ASBESTOS		4

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.


**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H104A	CARETAKER LUNCHROOM	FLOOR TILE	12"X12" OFF WHITE FLOOR TILE	FLOORS	80 SQ. FT.	SA85	5	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	FLOOR TILES CONTAIN ASBESTOS		4
		FLOOR TILE	12"X12" OFF WHITE FLOOR TILE	FLOORS	28 SQ. FT.	SA85	5	CHRYSTILE	POOR	YES	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING VINYL FLOOR TILES SHOULD BE REMOVED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	AT RADIATOR	8	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
H104C	CARETAKER LUNCHROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	DOMESTIC WATER LINE. CEILING SPACE/GENERAL ROOM	20	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	85 SQ. FT.	R-SA98		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE			4
H105	LAB	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	7	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE	LOCATED AT ENTRANCE. SOME PIPE FITTING INSULATION HAS BEEN REMOVED AND REPLACED WITH NON-ASBESTOS, FIBERGLASS INSULATION.		4
		TRANSITE MATERIAL	TRANSITE COUNTER TOP	COUNTER	30 SQ. FT.	N/A	N/A		GOOD	SUSPECT	A	NON-FRIABLE	APPEARS TO BE REMOVED, NOT OBSERVED DURING THE 2021 REASSESSMENT SURVEY		N/A
H105C	LAB	NO SUSPECT ACM OBSERVED													N/A
H106	STORAGE	NO SUSPECT ACM OBSERVED								NO					N/A
H106E	ELEVATOR	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H107	ELECTRICAL	NO SUSPECT ACM OBSERVED								NO			ACM MAY BE PRESENT WITHIN THE INTERNAL COMPONENTS OF ELECTRICAL EQUIPMENT		N/A
H108S	STAIRWELL	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	9	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
H109	ELECTRICAL	NO SUSPECT ACM OBSERVED								NO					N/A
H110	PIPE TUNNEL	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	181	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE	1 FITTING REMOVED IN 2018 (MAPLE PROJECT #16940). 4 FITTINGS REMOVED IN 2019 (MAPLE PROJECT #18151). APPROXIMATELY 23 LINEAR FT. REMOVED IN 2020 (OHE PROJECT #25966). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H110A	PIPE TUNNEL	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	5	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE	1 FITTING REMOVED IN 2018 (MAPLE PROJECT #16940). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H110S	STAIRWELL	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	4	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
H111	GEO LAB / ENV SCIENCES	FLOOR TILE AND MASTIC	9"X9" BROWN FLOOR TILE AND MASTIC	FLOORS	90 SQ. FT	SA86	1.8	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	ASBESTOS DETECTED IN BOTH THE FLOOR TILES AND THE MASTIC.		4
		NEW DRYWALL WALLS								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H111A	GEO LAB / ENV SCIENCES	FLOOR TILE AND MASTIC	9"X9" BROWN FLOOR TILE AND MASTIC	FLOORS	90 SQ. FT	SA86	1.8	CHRYSTILE	GOOD				ASBESTOS DETECTED IN BOTH THE FLOOR TILES AND THE MASTIC.		4
		NEW DRYWALL WALLS								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H111K	CORRIDOR	TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H112	CLEANERS SHAFT	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	IN SHAFT	20	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
H112A	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM - AT RADIATOR UNIT (LIKELY ADDITIONAL QUANTITIES IN THE CEILING SPACE)	2	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
		CEILING TILE	2'X4' SMALL PINHOLE & LENGTHWISE FISSURES	CEILING	100 SQ. FT.				GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		PLASTER	PLASTER	CEILING		25622-023-7A-C		ND		NO			SAMPLED BY OHE (PROJECT #25622-023) IN 2022		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALLS		25622-023-6A-C		ND		NO			SAMPLED BY OHE (PROJECT #25622-023) IN 2022		N/A
H113	STORAGE	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	10	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	2 FITTINGS AT RADIATOR REMOVED IN 2018 (MAPLE PROJECT #17660). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		DRYWALL	DRYWALL JOINT COMPOUND	CEILING	500 SQ. FT.	R-SA98		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		CEILING TILE	2'X4' SMALL PINHOLE & LENGTHWISE FISSURES	CEILING	45 SQ. FT.				GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
H114	WOMEN'S LUNCHROOM	NEW VINYL SHEET FLOORING	NEW - 2009							NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H114V	LOCKER ROOM VESTIBULE	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	2	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		FLOOR TILE AND MASTIC	9"X9" BROWN FLOOR TILE AND MASTIC	FLOORS	300 SQ. FT.	R-SA86	1.8	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	ACM DETECTED IN BOTH THE TILE AND MASTIC		4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	SHAFT	16	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

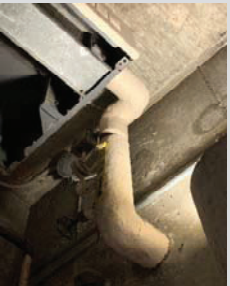
**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H114B	WASHROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	2	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	6	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	SHAFT(B/TOILETS)	20-25	R-SA1	50-75	CHRYSTILE	GOOD	YES	B/C	FRIABLE	VIEWED FROM H114A		4
H115	MEN'S LUNCHROOM	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW DRYWALL WALLS								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H115A	WASHROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	2	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	14	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		PLASTER	ROUGH GREY PLASTER	WALL			ND			NO			SAMPLED BY MAPLE (PROJECT #18668). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY		N/A
		PLASTER	OFF-WHITE TEXTURED PLASTER	WALL			<0.5			NO			SAMPLED BY MAPLE (PROJECT #18668). THIS MATERIAL IS NOT CONSIDERED ASBESTOS-CONTAINING AS PER O. REG. 278/05. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY		N/A
		GROUT	GROUT	WALL			ND			NO			SAMPLED BY MAPLE (PROJECT #18668). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY		N/A
		CERAMIC TILE BACKING	CERAMIC TILE BACKING	WALL			ND			NO			SAMPLED BY MAPLE (PROJECT #18668). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY		N/A
		CEILING TILE	2'X4' SMALL PINHOLE & LENGTHWISE FISSURES	CEILING			ND			NO			SAMPLED BY MAPLE (PROJECT #18657). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY		4
H116	MEN'S LOCKER ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	24	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOOR TO ROOM H116	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		FLOOR TILE	9"X9" LIGHT BROWN FLOOR TILE	FLOORS	170 SQ. FT.	R-SA83	5	CHRYSTILE	GOOD	YES	B	NON-FRIABLE			4
H116A	MEN'S LOCKER ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	24	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOOR TO ROOM H116	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		FLOOR TILE	9"X9" LIGHT BROWN FLOOR TILE	FLOORS	170 SQ. FT.	R-SA83	5	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	APPEARS TO BE REMOVED, NOT OBSERVED DURING THE 2020 REASSESSMENT SURVEY		N/A
H116V	VESTIBULE	FLOOR TILE AND MASTIC	9"X9" BROWN FLOOR TILE AND MASTIC	FLOORS	46 SQ. FT.	R-SA86	1.8	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	ACM DETECTED IN BOTH THE TILE AND MASTIC		4
		FLOOR TILE AND MASTIC	9"X9" BROWN FLOOR TILE AND MASTIC	FLOORS	4 SQ. FT.	R-SA86	1.8	CHRYSTILE	POOR	YES	A	NON-FRIABLE	ACM DETECTED IN BOTH THE TILE AND MASTIC. THE DAMAGED ASBESTOS-CONTAINING VINYL FLOOR TILES SHOULD BE REMOVED AND REPLACED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
H200	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	4	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
H200A	SHAFT	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	EXTERIOR WALL	8 SQ. FT.	R-SA22	15-25	CROCIDLITE	GOOD	YES	B/C	NON-FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	50-65	R-SA73	50-75	CHRYSTILE	GOOD	YES	B/C	FRIABLE	6 FITTINGS REMOVED IN 2018 (MAPLE PROJECT #16940). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H200E	ELEVATOR	NO SUSPECT ACM OBSERVED								NO					N/A
H200K	CORRIDOR	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	WALL	8 SQ. FT.	R-SA22	15-25	CROCIDLITE	GOOD	YES	B/C	NON-FRIABLE			4
H201	VENDOR AREA	DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	S01A-C	ND	ND		NO			SAMPLED BY MAPLE (PROJECT #17190). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		MASTIC	GREY AND BROWN FLOORING MASTIC	BELOW COOLER			ND	ND		NO			SAMPLED BY MAPLE (PROJECT #18603). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
H201A	VENDOR AREA	DRYWALL	DRYWALL JOINT COMPOUND					ND		NO			SAMPLED BY MAPLE (PROJECT #18765B). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected


Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H201S	STAIRWELL	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	2	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	1	R-SA73	50-75	CHRYSTILE	POOR	YES	A	FRIABLE	THE DAMAGED ASBESTOS-CONTAINING MSI SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES OR REMOVED FOLLOWING TYPE 2 GLOVE BAG PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
H202	KITCHEN AND COOLERS	TAR UNDER FIBERGLASS	TAR	ABOVE CEILING	UNKNOWN				GOOD	SUSPECT	C	NON-FRIABLE	PRIOR TO RENOVATIONS, ADDITIONAL ASSESSMENT AND SAMPLING IS RECOMMENDED.		4
		DRYWALL	DRYWALL JOINT COMPOUND					ND		NO			SAMPLED BY MAPLE (PROJECT #18765B), TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		MASTIC	GREY MASTIC	BASE OF WALL BY FREEZER			ND			NO					N/A
H202A	CATERING ROOM	DRYWALL	DRYWALL JOINT COMPOUND	WALL		25622-023-8A-C		ND		NO			SAMPLED BY OHE (PROJECT #25622-023) IN 2022		N/A
		TAR UNDER FIBERGLASS	TAR	ABOVE CEILING	UNKNOWN				GOOD	SUSPECT	C	NON-FRIABLE	PRIOR TO RENOVATIONS, ADDITIONAL ASSESSMENT AND SAMPLING IS RECOMMENDED.		4
H202E	ELEVATOR	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H204	CLEANERS CLOSET	NO SUSPECT ACM OBSERVED								NO					N/A
H205	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	WALL				ND					SAMPLED BY MAPLE (PROJECT #18765B), TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		CEILING TILE	NON-ASBESTOS DRYWALL CEILING TILES	CEILING						NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		FLOOR TILE AND MASTIC	12"X12" BEIGE VINYL FLOOR TILES AND MASTIC	FLOOR	200 SQ. FT				GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS, ADDITIONAL ASSESSMENT AND SAMPLING IS RECOMMENDED.		4
H205A	CLOSET	NO SUSPECT ACM OBSERVED								NO			LIMITED ACCESS FURTHER INVESTIGATION REQUIRED		N/A
H206K	CORRIDOR	NO SUSPECT ACM OBSERVED								NO					N/A
H207	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	R-SA98	1	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #18765B), TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		FLOOR TILE AND MASTIC	12"X12" BEIGE VINYL FLOOR TILES AND MASTIC	FLOOR	200 SQ. FT				GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS, ADDITIONAL ASSESSMENT AND SAMPLING IS RECOMMENDED.		4
H208	MEN'S CHANGE ROOM	DRYWALL	DRYWALL JOINT COMPOUND		UNKNOWN		2	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (MAPLE PROJECT #18765B), TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H208A	MEN'S CHANGE ROOM	NO SUSPECT ACM OBSERVED								NO			ACM SUSPECTED TO BE PRESENT IN INACCESSIBLE AREAS (E.G. WALL CAVITIES)		N/A
H209	WOMEN'S CHANGE ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL CAVITY	UNKNOWN	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	LIMITED ACCESS TO WALL CAVITY (PRESENT IN LARGE STALL WASHROOM)		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	R-SA98	2	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (MAPLE PROJECT #18765B), TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H209A	CUSTODIAL CLOSET	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	R-SA98		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
H209K	CORRIDOR	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	R-SA98		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
H210	DISH ROOM	NEW DRYWALL WALLS	NEW - 2005							NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		CEILING TILE	NON-ASBESTOS CEILING TILES	CEILING						NO			NOT SUSPECTED TO CONTAIN ASBESTOS. ACM IS SUSPECTED IN WALL CAVITY BEHIND THE SINK AND IN INACCESSIBLE AREAS.		N/A
H210A	STORAGE ROOM	NEW DRYWALL WALLS	NEW - 2005							NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		CEILING TILE	NON-ASBESTOS CEILING TILES	CEILING						NO			NOT SUSPECTED TO CONTAIN ASBESTOS. ACM IS SUSPECTED IN WALL CAVITY BEHIND THE SINK AND IN INACCESSIBLE AREAS.		N/A
H212	SEATING AREA	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H212A	SEATING AREA	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H212S	SEATING AREA	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H213	FOOD SERVICES DIRECT OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A
H214	LECTURE HALLS	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	1700 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		DRYWALL	DRYWALL JOINT COMPOUND	CEILING	1700 SQ. FT.	SA11-B-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
H214A	STUDY SPACE	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	500 SQ. FT	R-SA22	15-25	CROCIDLITE	GOOD	YES	B	NON-FRIABLE			4
H214V	VESTIBULE	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H214S	STAIRCASE	NO SUSPECT ACM OBSERVED								NO					N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected



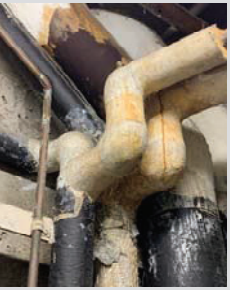


Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H215	LECTURE HALLS	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	1700 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PLASTER	CEILING PLASTER	CEILING		25622-023-9A-C		ND		NO			SAMPLED BY OHE (PROJECT #25622-023) IN 2022		N/A
H215A	STUDY SPACE	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	500 SQ. FT	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE			4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H215B	STUDY SPACE	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	500 SQ. FT	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE			4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H215V	VESTIBULE	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	ABOVE CEILING	5	R-SA73	50-75	CHRYSTOTILE	GOOD	YES	B	FRIABLE			4
H215S	STAIRCASE	NO SUSPECT ACM OBSERVED								NO					N/A
H216	LECTURE HALL	DRYWALL	DRYWALL JOINT COMPOUND	WALL	APPROX. 1500 SQ. FT.	18764-01E	1	CHRYSTOTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #18764). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		DRYWALL	DRYWALL JOINT COMPOUND	CEILING	APPROX. 7 SQ. FT.	18764-01E	1	CHRYSTOTILE	POOR	YES	A	FRIABLE	SAMPLED BY MAPLE (PROJECT #18764) IN 2020. THE DAMAGED ASBESTOS-CONTAINING DRYWALL SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		CAULKING	GREY CAULKING	DOOR TO PROJECTION ROOM		18764-09A-C	1	CHRYSTOTILE		YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #18764) IN 2020. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	N/A	N/A	3	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		MECHANICAL SYSTEMS INSULATION	TAPE ON INSULATION	TAPE APPLIED TO SEAMS OF FOIL FACED FIBREGLASS BATT INSULATION		18764-02A-C	80	CHRYSTOTILE		YES			SAMPLED BY MAPLE (PROJECT #18764). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		FABRIC BACKING	FABRIC BACKING	BEHIND WOOD SLAT WALL		18764-03A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18764). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		MASTIC	BROWN MASTIC	BASEBOARD MASTIC		18764-06A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18764). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		PLASTER	GREY AND WHITE PLASTER	CEILING		25952-1A-C; 18764-1A-D, 18764-5A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18764). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY. SAMPLED BY OHE (PROJECT #25952) IN 2020. PORTIONS OF THE CEILING REMOVED IN 2020 (OHE PROJECT #26123). VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		N/A
H216A	LECTURE HALL (SOUTH SIDE OF HW216)	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	N/A	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PLASTER	PLASTER	CEILING BULKHEAD						NO					N/A
H216B	STUDY SPACE	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	2 SQ. FT.	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE	LIMITED ACCESS		4
H216C	MEETING ROOM	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	500 SQ. FT	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE	MINOR DAMAGES OBSERVED DURING THE 2022 REASSESSMENT, MONITOR FUTURE CONDITION		4
		DRYWALL	NEW - 2020										NEW - 2020		
		BLACK CAULKING	INTERIOR WINDOW CAULKING	EXTERIOR WALL		18297 S14A-C		ND		NO			SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT #18297). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		WHITE CAULKING	AT DRYWALL BULKHEAD	WEST SIDE		18297 S16A-C		ND		NO			SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT #18297). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		BROWN FIRESTOP	PIPE PENETRATE	ENTERING EXTERIOR WALL	2 SQ. FT.	18297 S15A	5	CHRYSTOTILE	GOOD	YES	B	FRIABLE	SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT #18297). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H216K	LECTURE HALL (NORTH SIDE OF HW216)	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	N/A	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H216S	STAIRCASE	PLASTER	PLASTER	CEILING BULKHEAD						NO					N/A
		NO SUSPECT ACM OBSERVED								NO					N/A
H216T	UNDERNEATH STAIRCASE	NO SUSPECT ACM OBSERVED								NO					N/A
H216V	VESTIBULE	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

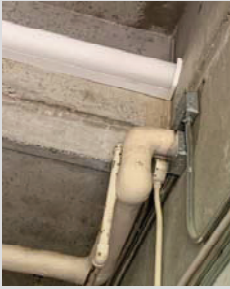

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H217	PROJECTION ROOM (2 FLOORS)	DRYWALL	DRYWALL JOINT COMPOUND	WALL IN LOWER LEVEL AND MEZZANINE			1	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE IN 2020 (MAPLE PROJECT #18764). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL IN LOWER LEVEL AND MEZZANINE	5 SQ. FT.	18764-11A-12C	1	CHRYSTILE	POOR	YES	A	NON-FRIABLE	THE DAMAGED DRYWALL SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		FLOOR TILE AND MASTIC	12"X12" GREY FLOOR TILE AND MASTIC	LOWER LEVEL		18764-08A-C	2	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	ACM DETECTED IN BOTH THE TILE AND MASTIC		4
		CAULKING	GREY CAULKING	DOOR TO PROJECTION ROOM		18764-09A-C	1	CHRYSTILE		YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #18764) IN 2020. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		REFER TO H217											Refer to H217		N/A
H218	STORAGE ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS		3	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	1	R-SA73	50-75	CHRYSTILE	POOR	YES	B	FRIABLE	THE DAMAGED ASBESTOS-CONTAINING MSI SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		CEILING TILE	2'X4' CEILING TILE WITH LARGE WIDTHWISE FISSURES			R-SA11 & R-SA120-(A-F)-06		ND		NO					N/A
H218A	STORAGE ROOM	CEILING TILE	2'X4' CEILING TILE WITH LARGE WIDTHWISE FISSURES			R-SA11 & R-SA120-(A-F)-06		ND		NO					N/A
H219	WOMEN'S WASHROOM	DRYWALL	DRYWALL JOINT COMPOUND	WALL						NO			ALL ASBESTOS-CONTAINING MATERIALS WERE ABATED DURING THE WASHROOMS RENOVATION PROJECT (PROJECT #DCM2010-11)		N/A
H219K	CORRIDOR	NO SUSPECT ACM OBSERVED								NO					N/A
H220	STAIRWELL	NO SUSPECT ACM OBSERVED								NO					N/A
H220A	STUDY SPACE	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	500 SQ. FT	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE			4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H220S	STAIRWELL	NO SUSPECT ACM OBSERVED								NO					N/A
H220T	STAIRCASE	NO SUSPECT ACM OBSERVED								NO					N/A
H221	MEN'S WASHROOM	DRYWALL	DRYWALL JOINT COMPOUND	WALL						NO			ALL ASBESTOS-CONTAINING MATERIALS WERE ABATED DURING THE WASHROOMS RENOVATION PROJECT (PROJECT #DCM2010-11)		N/A
H222	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	5	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
H222A	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	8	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	2	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE	THE DAMAGED ASBESTOS-CONTAINING MSI SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H223A	STUDY SPACE	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	500 SQ. FT	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE			4
H223K	CORRIDOR	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NO SUSPECT ACM OBSERVED								NO					N/A
H223S	STAIRWELL	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	3	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	1	R-SA73	50-75	CHRYSTILE	POOR	YES	A	FRIABLE	THE DAMAGED ASBESTOS-CONTAINING MSI SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
H224	ELECTRICAL	NO SUSPECT ACM OBSERVED								NO			ACM MAY BE PRESENT WITHIN THE INTERNAL COMPONENTS OF ELECTRICAL EQUIPMENT		N/A
H224A	DINING AREA	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H224E	ELEVATOR	TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE ELEVATOR DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
H224K	CORRIDOR	NO SUSPECT ACM OBSERVED								NO					N/A
H225	DINING AREA	NO SUSPECT ACM OBSERVED								NO					N/A
H225A	DINING AREA	NO SUSPECT ACM OBSERVED								NO			LIMITED ACCESS ABOVE CEILING TILES - PRIOR TO RENOVATIONS ADDITIONAL ASSESSMENT FOR HAZARDOUS MATERIALS IS RECOMMENDED.		N/A
H225K	CORRIDOR	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	ABOVE WINDOWS - EXTERIOR SOFFIT OVERHANGS	800 SQ. FT	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE			4
H300	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	12	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
H300A	MEZZANINE	NO SUSPECT ACM OBSERVED								NO					N/A
H301E	ELEVATOR	VINYL SHEET FLOORING		FLOORS	75 SQ. FT	R-SA111-(A-B)-06		ND		NO			ELEVATOR SHAFT WAS NOT INVESTIGATED - ASSESSMENT REQUIRED		N/A
H301K	CORRIDOR	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	15-20	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE IN FRONT OF H300A	2	R-SA73	50-75	CHRYSTILE	FAIR	YES	C	FRIABLE	UNJACKETED PARGING CEMENT FITTING PRESENT ABOVE CEILING IN FRONT OF H300A. THE DAMAGED ASBESTOS-CONTAINING PARGING CEMENT INSULATION SHOULD BE REMOVED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE ELEVATOR DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H301S	STAIRWELL	TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
H301V	VESTIBULE	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	4	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	ONLY 1 FITTING OBSERVED DURING 2020 REASSESSMENT- PRESUMED TO BE PRESENT		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H302A	ROOMS/OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A
H302B	ROOMS/OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A
H302C	ROOMS/OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A
H302E	ROOMS/OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A
H302F	ROOMS/OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 – Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 – Perform asbestos removal/repair for compliance with the regulations.  
3 – Type 2 asbestos procedures required to enter area.  
4 – Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A – Not applicable.

**Definitions**  
ACM – Asbestos-Containing Materials  
SA – Sample representative  
R-SA – Sample referenced to a visually similar homogeneous sample material.  
ND – None detected



Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H302G	ROOMS/OFFICE	PLASTER	PLASTER FINISH ON WALL (FINISH COAT + BASE COAT)	WALL		PLA-01-d-e		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #21500921). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		CEILING TILE	2'X2' LENGTH WISE FISSURE	CEILING SPACE		ACT-01a-c		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #21500921). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		GREY CAULKING	GREY CAULKING AROUND DRYWALL SHEETS	CEILING SPACE		CLK-02a-c		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #21500921). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		OFF-WHITE CAULKING	OFF-WHITE CAULKING AROUND DRYWALL SHEETS	CEILING SPACE		CLK-03a-c		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #21500921). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		DJC-02a-c		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #21500921). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		CARPET MASTIC	CARPET MASTIC	FLOOR		CM-01a-c		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #21500921). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
H302K	ROOMS/OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A
H302L	ROOMS/OFFICE	NO SUSPECT ACM OBSERVED								NO					N/A
H302V	ROOMS/OFFICE	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	2				GOOD	YES	C	FRIABLE	3 FITTINGS REMOVED IN NOV 2022 (GOLDER PROJECT 22565808). 2 FITTINGS REMAIN.		4
H305	DINING HALL ABOVE MARKET PLACE	DOOR	BROWN CORE OF DOOR	DOOR		S01A-C		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #17017). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
	DINING HALL ABOVE MARKET PLACE	DOOR	BROWN MASTIC BELOW LAMINATE	DOOR		S02A-C		ND		NO			SAMPLED BY MAPLE (MAPLE PROJECT #17017). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
H305S	MARKET PLACE - SEATING AREA	NO SUSPECT ACM OBSERVED								NO			NO ACCESS ABOVE CEILING		N/A
H306	ELECTRICAL ROOM	NO SUSPECT ACM OBSERVED								NO					N/A
H306E	ELEVATOR	NO SUSPECT ACM OBSERVED								NO					N/A
H306K	CORRIDOR	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	9	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	OBSERVED OUTSIDE LOCATION H305		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H307	CLEANERS ROOM	NO SUSPECT ACM OBSERVED								NO					N/A
H308	CLASSROOM	CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		SA4-A-08		ND		NO					N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	400 SQ. FT.	SA98 & SA12-A-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H308K	CORRIDOR	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	15	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL SPACE	17	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL OUTSIDE H308K	10 SQ. FT.	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	WALL AT TOP OF STAIRS	9 SQ. FT.	R-SA22	15-25	CROCIDLITE	GOOD	YES	A	NON-FRIABLE			4
H308S	STAIRCASE	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		SA4-B-08		ND		NO					N/A
H309	CLASSROOM	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		SA4-B-08		ND		NO					N/A
H309A	CLASSROOM	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H309B	CLASSROOM	CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		SA4-B-08		ND		NO					N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H309C	CLASSROOM	CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		SA4-B-08		ND		NO					N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H309K	CORRIDOR	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	15	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	ADJACENT TO H308		4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL SPACE	24	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H309S	STAIRCASE	NO SUSPECT ACM OBSERVED								NO					N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected






Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H310	CLASSROOM	CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		SA4-C-08		ND		NO					N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA12-B-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
H310K	CORRIDOR	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	12	R-SA73	50-75	CHRYSTOTILE	GOOD	YES	C	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL SPACE	24	R-SA73	50-75	CHRYSTOTILE	GOOD	YES	A	FRIABLE	2 FITTINGS REMOVED IN 2018 (MAPLE PROJECT #17708). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H310S	STAIRCASE	NO SUSPECT ACM OBSERVED								NO					N/A
H310V	VESTIBULE	NO SUSPECT ACM OBSERVED								NO					N/A
H311A	PROJECTION ROOM	REFER TO H217								NO					N/A
H311K	CORRIDOR	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	11	R-SA73	50-75	CHRYSTOTILE	GOOD	YES	C	FRIABLE	TRANSITE CEMENT BOARD REMOVED IN 2018, AND 1 FITTING REMOVED IN 2019 (MAPLE PROJECT #17705).TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H311S	PROJECTION ROOM	REFER TO H217								NO					N/A
H311T	STAIRCASE	ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	WOODEN BULKHEAD BETWEEN H335K AND STAIRCASE H311T	250 SQ. FT.	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE			4
H311V	VESTIBULE	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	2				GOOD	SUSPECT	C	FRIABLE			4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H312	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	WEST AND SOUTH WALL	UNKNOWN	18215 S01A	1	CHRYSTOTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #18215) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H313	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	EAST, SOUTH AND WEST WALL	UNKNOWN	18215 S02A-C				NO			SAMPLED BY MAPLE (PROJECT #18215) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
H313A	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		DRYWALL	DRYWALL JOINT COMPOUND	SOUTH WALL	UNKNOWN	18215 S03A-C	ND	ND		NO			SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT 18215). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	160 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H314	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H315	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H315A	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	160 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H315K	CORRIDOR	NO SUSPECT ACM OBSERVED								NO					N/A
H316S	STAIRWELL	CAULKING, BLACK	DOOR CAULKING - GAP BETWEEN DOOR AND GLASS, STAIR A, FLOOR 3	DOOR		26417-1A	5	CHRYSTOTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY OHE (OHE PROJECT #26417) IN 2021. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		CAULKING, GREY	DOOR CAULKING - GAP BETWEEN DOOR AND GLASS, STAIR A, FLOOR 3	DOOR		26417-2A-C	<0.5	CHRYSTOTILE	GOOD	NO	A		SAMPLED BY OHE (PROJECT #26417) IN 2021. THIS MATERIAL IS NOT CONSIDERED ASBESTOS-CONTAINING AS PER O. REG. 278/05. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 – Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 – Perform asbestos removal/repair for compliance with the regulations.  
3 – Type 2 asbestos procedures required to enter area.  
4 – Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A – Not applicable.

**Definitions**  
ACM – Asbestos-Containing Materials  
SA – Sample representative  
R-SA – Sample referenced to a visually similar homogeneous sample material.  
ND – None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H316V	VESTIBULE	DRYWALL	DRYWALL JOINT COMPOUND	WALL	400 SQ. FT.	25622-023-1A-C	1	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY OHE (PROJECT 25622-023) IN 2022.		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	7 SQ. FT.	25622-023-1A-C	1	CHRYSTILE	POOR	YES	A	NON-FRIABLE	SAMPLED BY OHE (PROJECT 25622-023) IN 2022. THE DAMAGED ASBESTOS-CONTAINING DRYWALL SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
H317A	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H317	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H318	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H319	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H320	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4

**Level of Accessibility**

A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos removal/repair required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**

ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H321	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H322	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H323	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H324	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H325	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H326	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H327	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H328	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4

**Level of Accessibility**

A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**

ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected


Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H329	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H330	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H331	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H331K	CORRIDOR	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H331A	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA12-B-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H332A	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA12-C-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		R-SA11		ND		NO					N/A
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H332S	STAIRWELL	NO SUSPECT ACM OBSERVED NEW LAY-IN CEILING TILES								NO NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A N/A
H332V	VESTIBULE	DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	25622-023-2A-C	1	CHRYSTOTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY OHE (PROJECT 25622-023) IN 2022.		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	5 SQ. FT.	25622-023-2A-C	1	CHRYSTOTILE	POOR	YES	A	NON-FRIABLE	SAMPLED BY OHE (PROJECT 25622-023) IN 2022. THE DAMAGED ASBESTOS-CONTAINING DRYWALL SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PRESUMED ASBESTOS CEMENT BOARD	CEMENT BOARD	MAY BE PRESENT BEHIND RADIATORS	UNKNOWN				GOOD	SUSPECT	C	NON-FRIABLE			4
H333	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H334	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	CEMENT BOARD	MAY BE PRESENT BEHIND RADIATORS	UNKNOWN				GOOD	SUSPECT	C	NON-FRIABLE			4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 – Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 – Perform asbestos removal/repair for compliance with the regulations.  
3 – Type 2 asbestos procedures required to enter area.  
4 – Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A – Not applicable.

**Definitions**  
ACM – Asbestos-Containing Materials  
SA – Sample representative  
R-SA – Sample referenced to a visually similar homogeneous sample material.  
ND – None detected



Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H335	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	CEMENT BOARD	MAY BE PRESENT BEHIND RADIATORS	UNKNOWN				GOOD	SUSPECT	C	NON-FRIABLE			4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		DRYWALL	DRYWALL JOINT COMPOUND	SOUTH WALL	150 SQ. FT.	18207 S01A	1	CHRYSTOTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT #18207). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		DRYWALL	DRYWALL JOINT COMPOUND	SOUTH WALL	1 SQ. FT.	18207 S01A	1	CHRYSTOTILE	FAIR	YES	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
H335K	CORRIDOR	PRESUMED ASBESTOS CEMENT BOARD	CEMENT BOARD	MAY BE PRESENT BEHIND RADIATORS	UNKNOWN				GOOD	SUSPECT	C	NON-FRIABLE			4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	WOODEN BULKHEAD BETWEEN H335K AND STAIRCASE H311T	250 SQ. FT.	R-SA22	15-25	CROCIDOLITE	GOOD	YES	B	NON-FRIABLE			4
H400	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	11	R-SA73	50-75	CHRYSTOTILE	GOOD	YES	B	FRIABLE			4
H401E	ELEVATOR	NO SUSPECT ACM OBSERVED								NO					N/A
H401S	STAIRWELL	TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
H401K	CORRIDOR	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE OUTSIDE OF H400	5	R-SA73	50-75	CHRYSTOTILE	GOOD	YES	C	FRIABLE	OUTSIDE OF H400		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H402	CLASSROOM	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	575 SQ. FT.	N/A	N/A	CHRYSTOTILE	GOOD	YES	B	NON-FRIABLE	ORANGE 9"x9" VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		TEXTURE COAT	TEXTURE COAT	CEILING SPACE	575 SQ. FT.	SA2-B-08		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H402K	CORRIDOR	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	33	R-SA73	50-75	CHRYSTOTILE	GOOD	YES	C	FRIABLE	NOT OBSERVED DURING 2021 REASSESSMENT- PRESUMED TO BE PRESENT		4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	2	R-SA1	50-75	CHRYSTOTILE	GOOD	YES	C	FRIABLE	NOT OBSERVED DURING 2021 REASSESSMENT- PRESUMED TO BE PRESENT		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H403	OFFICE	CEILING TILE	1'X1' GLUE IN CEILING TILES	CEILING		17846 S06		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		TAN MASTIC	CEILING MASTIC	CEILING		17846 S07		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		PLASTER	SMOOTH PLASTER	CEILING		17846 S08		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		17846 S09		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 – Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 – Perform asbestos removal/repair for compliance with the regulations.  
3 – Type 2 asbestos procedures required to enter area.  
4 – Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A – Not applicable.

**Definitions**  
ACM – Asbestos-Containing Materials  
SA – Sample representative  
R-SA – Sample referenced to a visually similar homogeneous sample material.  
ND – None detected



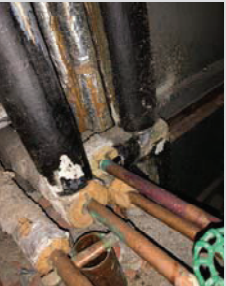
Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H403A	HUMANITIES RESEARCH TECH CENTRE	CEILING TILE	1'X1' GLUE IN CEILING TILES	CEILING		17846 S04		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		TAN MASTIC	CEILING MASTIC	CEILING		17846 S05		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		17846 S02		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		NEW VINYL SHEET FLOORING	GREEN VINYL SHEETING	FLOORS		17846 S01		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		BROWN MASTIC	FLOOR MASTIC	FLOORS		17846 S01		ND		NO			SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		DOOR CAULKING	DOOR CAULKING	DOOR	UNKNOWN	17846 S03	1	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #17846) IN 2019 . TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H404	TEACHING ASSISTANTS OFFICE	TEXTURE COAT	TEXTURE COAT	CEILING SPACE	525 SQ. FT.	SA2-C-08		ND		NO			NOT OBSERVED DURING 2021 REASSESSMENT, PRESUMED TO BE PRESENT		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	12	R-SA1	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		DRYWALL AND PLASTER	DRYWALL JOINT COMPOUND & SMOOTH PLASTER	NORTH AND WEST WALLS	UNKNOWN	18297 S01A-C	ND	ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		DRYWALL AND PLASTER	DRYWALL JOINT COMPOUND & SMOOTH PLASTER	SOUTH WALL	UNKNOWN	18297 S02A-C	<0.5 TR	ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. THIS MATERIAL IS NOT CONSIDERED ASBESTOS-CONTAINING AS PER O. REG. 278/05. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H404A	OFFICE	YELLOW MASTIC	FLOORING MASTIC	BELOW VINYL SHEET FLOORING	UNKNOWN	18297 S03A-C	ND	ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		MASTIC	CARPET MASTIC	FLOORS		CM-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		VINYL SHEET FLOORING	BEIGE VINYL SHEET FLOORING	FLOORS		VSF-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		BEIGE MASTIC	FLOOR ADHESIVE	FLOORS		VSF-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		MASTIC	FLOOR MASTIC	FLOORS		FM-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		CERAMIC TILE GROUT	CERAMIC TILE GROUT	FLOORS		CTGa-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		MASTIC	BASEBOARD MASTIC	BEHIND VINYL BASEBOARD		BA-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		DJC-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		DJC-02a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		PLASTER	FINISH COAT	WALL		PLA-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		PLASTER	BASE COAT	WALL		PLA-01a-ct				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		CEILING TILE	2'X2' PINHOLE LAY-IN CEILING TILE	CEILING SPACE		ACT-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		GREY MASTIC	DUCT/VENT MASTIC	CEILING SPACE		DM-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		BELLS AND SPIGOTS	BELLS AND SPIGOTS	ABOVE CEILING	7				GOOD	SUSPECT	C	NON-FRIABLE			4
		GREY/BLACK/BEIGE CAULKING	DOOR CAULKING	DOOR		CLK-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		GREY CAULKING	CAULKING AROUND DRYWALL SHEETS	CEILING SPACE		CLK-02a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		OFF-WHITE CAULKING	CAULKING AROUND DRYWALL SHEETS	CEILING SPACE		CLK-03a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		ASBESTOS CEMENT BOARD	ASBESTOS CEMENT BOARD	BY RADIATOR	20 SQ. FT	R-SA22	15-25	CROCIDOLITE	GOOD	YES	C	NON-FRIABLE			4
H404B	OFFICE	CARPET	VINYL SHEET FLOORING	FLOORS					GOOD	SUSPECT			FLOOR TILE MAY STILL BE PRESENT BENEATH (2009-VINYL SHEET FLOORING)		4
		CERAMIC TILE GROUT	CERAMIC TILE GROUT	FLOORS		CTGa-c							SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		MASTIC	FLOOR MASTIC	FLOORS		FM-01a-c							SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		VINYL SHEET FLOORING	BEIGE VINYL SHEET FLOORING	FLOORS		VSF-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		BEIGE MASTIC	FLOOR ADHESIVE	FLOORS		VSF-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		GREY MASTIC	DUCT/VENT MASTIC	CEILING SPACE		DM-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		GREY/BLACK/BEIGE CAULKING	DOOR CAULKING	DOOR		CLK-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		PLASTER	FINISH COAT	WALL		PLA-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		PLASTER	BASE COAT	WALL		PLA-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		BASEMENT ADHESIVE	BASEBOARD MASTIC	WALL		BA-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		DJC-01a-c				NO			SAMPLED BY GOLDER (MAPLE PROJECT #21500921).		N/A
H404D	LANGUAGE RESOURCES ROOM	VINYL SHEET FLOORING	GREY VINYL SHEET FLOORING	FLOOR		18297 S20A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		BLACK & YELLOW MASTIC	FLOORING MASTIC	BELOW VINYL SHEET FLOORING		18297 S20A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	SOUTH, NORTH AND WEST WALLS		18297 S17A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		SMOOTH PLASTER	SMOOTH PLASTER	SOUTH, NE AND SW WALLS		18297 S18A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		GREY CAULKING	CAULKING AROUND VENT	MIDDLE OF ROOM		18297 S19A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18297) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		BELLS AND SPIGOTS	BELLS AND SPIGOTS	ABOVE CEILING					GOOD	SUSPECT	C	NON-FRIABLE			4
H404K	CORRIDOR	NEW VINYL SHEET FLOORING	NEW - 2009							NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW DRYWALL WALLS								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H405	ELECTRICAL ROOM	NO SUSPECT ACM OBSERVED								NO			ACM MAY BE PRESENT AS COMPONENTS OF ELECTRICAL EQUIPMENT		N/A
H406	WOMEN'S WASHROOM	NEW DRYWALL CEILING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H406E	ELEVATOR	NO SUSPECT ACM OBSERVED								NO					N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H406K	CORRIDOR	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW DRYWALL CEILING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL SPACE	7	R-SA1	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
H407	MEN'S WASHROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL SPACE	3	R-SA1	50-75	CHRYSTILE	FAIR	YES	B	FRIABLE	RESIDUAL PARGING CEMENT FITTINGS PRESENT ON THREE FITTINGS WITHIN THE WALL SPACE. THE RESIDUAL DEBRIS SHOULD BE REMOVED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
H408	CLASSROOM	TEXTURE COAT	TEXTURE COAT	CEILING SPACE	672 SQ. FT.	SA84 & SA2-A-08		ND		NO					N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H408A	MAIL ROOM	NEW DRYWALL WALLS AND CEILING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H408B	ROOM	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009; HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		NEW DRYWALL CEILING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009; HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H409	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	NORTH, EAST AND SOUTH WALL		18215 S04A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18215) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	45 SQ. FT	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009; HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H409A	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	EAST WALL	UNKNOWN	18215 S05A-C	1	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #18215) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	45 SQ. FT	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	125 SQ. FT.	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE			4
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS TO WASHROOMS AND MECHANICAL ROOMS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	ACROSS FROM RM HW409	1	R-SA1	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	CEILING SPACE	1	R-SA1	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE	LOCATED ACROSS FROM THE DOOR TO ROOM H409.		4

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected



Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing


Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H410	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA13-B-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	45 SQ. FT.	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H411	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA13-B-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	45 SQ. FT.	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H411A	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA13-B-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	45 SQ. FT.	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H412	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA13-B-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	APPEARS TO BE REMOVED, NOT OBSERVED DURING THE 2020 REASSESSMENT SURVEY		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H413S	STAIRWELL	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 – Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 – Perform asbestos removal/repair for compliance with the regulations.  
3 – Type 2 asbestos procedures required to enter area.  
4 – Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A – Not applicable.

**Definitions**  
ACM – Asbestos-Containing Materials  
SA – Sample representative  
R-SA – Sample referenced to a visually similar homogeneous sample material.  
ND – None detected



Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H413V	VESTIBULE	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	IN RADIATOR UNIT	1	R-SA73	50-75	CHRYSTILE	FAIR	YES	C	FRIABLE	DAMAGED PARGING CEMENT FITTING PRESENT WITHIN THE RADIATOR UNIT. THE DAMAGED ASBESTOS-CONTAINING PARGING CEMENT INSULATION SHOULD BE REMOVED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
H414	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	45 SQ. FT.	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H415	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H416	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H417	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H418	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4

**Level of Accessibility**

A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**

ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected




Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H419	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H420	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H421	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H422	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H423	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H424	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H425	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H426	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 – Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 – Perform asbestos removal/repair for compliance with the regulations.  
3 – Type 2 asbestos procedures required to enter area.  
4 – Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A – Not applicable.



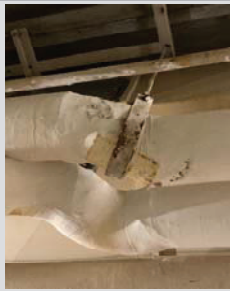
**Definitions**  
ACM – Asbestos-Containing Materials  
SA – Sample representative  
R-SA – Sample referenced to a visually similar homogeneous sample material.  
ND – None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H427	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H428	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H428A	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		A51834-16-18		CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE (PROJECT #18215). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY		4
		CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		R-SA11		ND		NO					N/A
H428B	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		DRYWALL	DRYWALL JOINT COMPOUND	EAST AND SOUTH WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		CEILING TILE	1'X1' LENGTH WISE FISSURE	CEILING SPACE		R-SA11		ND		NO					N/A
H429S	STAIRWELL	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		MECHANICAL SYSTEMS INSULATION	FITTINGS	MECHANICAL SHAFT #20						YES		FRIABLE	ASBESTOS CONTAINING PIPE ELBOWS HAS BEEN REMOVED ACCORDING TO UTSC DESIGN & CONSTRUCTION MANAGEMENT REPORT		N/A
H429V	VESTIBULE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	RADIATOR	1	R-SA1	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE	WITHIN RADIATOR		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		DRYWALL	DRYWALL JOINT COMPOUND	WALL		25622-023-3A-C	0.5	CHRYSTILE	POOR	YES	A	NON-FRIABLE	SAMPLED BY OHE IN (PROJECT #25622-023) 2022. THE DAMAGED ASBESTOS-CONTAINING DRYWALL SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H430	OFFICE	VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	R-SA82	5	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
H431	OFFICE	PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	R-SA82	5	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H432	OFFICE	DRYWALL	DRYWALL JOINT COMPOUND	SOUTH WALL		18215 S07A-C		ND		NO			SAMPLED BY MAPLE (PROJECT #18215) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		PRESUMED ASBESTOS CEMENT BOARD	TRANSITE™ ASBESTOS-CEMENT PANELS	LIKELY PRESENT WITHIN RADIATOR UNITS AT THE PERIMETER WALL	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT	C	NON-FRIABLE	PRESUMED ASBESTOS-CONTAINING TRANSITE™ PANELS ARE LIKELY LOCATED WITHIN THE RADIATOR UNITS, BUT ARE CONCEALED DUE TO THE OUTER WOODEN PANELS. PRIOR TO RENOVATIONS WHICH MAY AFFECT THE RADIATORS, AN INTRUSIVE INVESTIGATION SHOULD OCCUR TO DETERMINE THE PRESENCE OF ASBESTOS-CEMENT PANELS WITHIN THE RADIATOR UNITS.		4
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	180 SQ. FT.	R-SA82	5	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
H433	LANGUAGE LAB	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	6	R-SA73	50-75	CHRYSTILE	GOOD	YES	A	FRIABLE			4
		DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	SA13-D-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
H433A	MEETING ROOM	DRYWALL	DRYWALL JOINT COMPOUND	WALL	300 SQ. FT.	R-SA13-D-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		PLASTER	GREY PLASTER	WALL		25953-1A-C, 25953-2A-C				ND	A		SAMPLED BY OHE (PROJECT #25953) IN 2020.		N/A
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS TO WASHROOMS AND MECHANICAL ROOMS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
H433C	MAIL ROOM	DRYWALL	DRYWALL JOINT COMPOUND	WALL	UNKNOWN	R-SA13-D-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
H433K	CORRIDOR	TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	14	R-SA73	50-75	CHRYSTILE	GOOD	YES	B	FRIABLE			4
H434	MECHANICAL ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	2	R-SA73	50-75	CHRYSTILE	POOR	YES	B	FRIABLE	DAMAGED PARGING CEMENT FITTING PRESENT IN THE CEILING SPACE. THE DAMAGED ASBESTOS-CONTAINING PARGING CEMENT INSULATION SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES OR REMOVED FOLLOWING TYPE 2 GLOVE BAG PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		PLASTER	PLASTER	WALL		SA3-B-08		ND		NO					N/A
H435	MEN'S WASHROOM	DRYWALL	DRYWALL JOINT COMPOUND	CEILING	120 SQ. FT.	SA13-E-08		SUSPECT	GOOD	SUSPECT	A	NON-FRIABLE	PRIOR TO RENOVATIONS ADDITIONAL SAMPLING IS RECOMMENDED		4
		NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL	2				GOOD	YES	C	FRIABLE			4
H435A	CLEANERS	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL, INACCESSIBLE FROM MEN'S WASHROOM	1	R-SA73	50-75	CHRYSTILE	GOOD	YES	C	FRIABLE	ACM DEBRIS CLEANED IN 2019 (MAPLE PROJECT #18098), TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H436	WOMEN'S WASHROOM	NEW VINYL SHEET FLOORING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	WALL CHASE BELOW SINK	2	R-SA73	50-75	CHRYSTILE	GOOD	SUSPECT	C	FRIABLE			4

**Level of Accessibility**

A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.


**Level of Action Required**

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**

ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected



Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H437	MECHANICAL	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	18	R-SA73	50-75	CHRYSTILE	GOOD	YES	B/C	FRIABLE	REPAIRED IN 2009		4
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	2	R-SA73	50-75	CHRYSTILE	POOR	YES	B/C	FRIABLE	DAMAGED PARGING CEMENT FITTING PRESENT IN THE CEILING SPACE. THE DAMAGED ASBESTOS-CONTAINING PARGING CEMENT INSULATION SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES OR REMOVED FOLLOWING TYPE 2 GLOVE BAG PROCEDURES, AS PRESCRIBED UNDER O.REG. 278/05.		2
		TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
H437K	CORRIDOR	TEXTURE COAT	PAINTED TEXTURE COAT OVER PLASTER	WALL - ABOVE DOORS TO WASHROOMS AND MECHANICAL ROOMS	10 SQ. FT.	01 A-G		ND		NO			SAMPLED FROM VARIOUS LOCATIONS THROUGHOUT THE SCIENCE WING DURING THE 2016 REASSESSMENT.		N/A
		VINYL SHEET FLOORING	NEW - 2009	FLOORING MASTIC BELOW VSF	UNKNOWN	N/A	N/A	CHRYSTILE	GOOD	YES	B	NON-FRIABLE	VINYL FLOOR TILES WERE REMOVED IN 2009, HOWEVER ASBESTOS-CONTAINING MASTIC REMAINS (BENEATH THE NEW VINYL SHEET FLOORING).		4
5TH FLOOR	ALL AREAS	BEIGE CAULKING	DOOR CAULKING	ALL AREAS	UNKNOWN	18297 S04A	1	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	6 DOORS (IN ROOMS HW520, HW523, HW527 and HW528) INCLUDING CAULKING HAS BEEN REMOVED IN 2020 ACCORDING TO UTSC DESIGN AND CONSTRUCTION MANAGEMENT REPORT AND MAPLE PROJECT #18297 REPORT. THE CAULKING WAS SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT #18297). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY. ALL REMAINING BEIGE DOOR CAULKING PRESENT ON THE 5TH FLOOR SHOULD BE PRESUMED TO CONTAIN ASBESTOS.		4
5TH FLOOR	ALL AREAS	BLACK MASTIC	FLOOR MASTIC	ALL AREAS									REMOVED 2020 (MAPLE PROJECT #18297).		4
H500	CLEANERS	NO SUSPECT ACM OBSERVED								NO					N/A
H501E	ELEVATOR	NO SUSPECT ACM OBSERVED								NO					N/A
H501K	CORRIDOR	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	ABOVE CEILING	24				GOOD	YES	C	FRIABLE			4
H501S	STAIRWELL	NO SUSPECT ACM OBSERVED								NO					N/A
H502	MECHANICAL ROOM	PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	FITTINGS	GENERAL ROOM	50	R-SA73	50-75	CHRYSTILE	GOOD	YES	B/C	FRIABLE	INSULATION ON SOME OF THE PIPE FITTINGS WAS REMOVED IN 2022 (OHE PROJECT 28213)		4
H503	ROOF	ROOFING MATERIALS	ROOFING TAR AND FELT	ROOF	UNKNOWN	N/A	N/A	OTHER - comments	GOOD	SUSPECT		NON-FRIABLE	ACM IS SUSPECTED TO BE PRESENT IN THE ROOFING TAR AND FELT LAYERS. IF RENOVATION ACTIVITIES ARE SCHEDULED WHICH MAY AFFECT THE ROOFING MATERIALS, ADDITIONAL SAMPLING IS RECOMMENDED.		N/A
H503A	MECHANICAL ROOM	NO SUSPECT ACM OBSERVED								NO					N/A
H503B	MEN'S WASHROOM	NEW DRYWALL WALLS AND CEILING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		RED, GREY, LIGHT GREY AND WHITE CEMENTITIOUS MATERIAL						ND		NO					N/A
H504	WOMEN'S WASHROOM	NEW DRYWALL WALLS AND CEILING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		RED, GREY, LIGHT GREY CEMENTITIOUS MATERIAL						ND		NO					N/A
H504K	CORRIDOR	DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		SMOOTH PLASTER	SMOOTH PLASTER	NORTH WALL	UNKNOWN	18297 S06A-C	ND	ND		NO			SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT #18297). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		BEIGE CAULKING	DOOR CAULKING	OUTSIDE H501S	UNKNOWN	18297 S04A	1	CHRYSTILE	GOOD	YES	A	NON-FRIABLE	SAMPLED BY MAPLE IN 2019 (MAPLE PROJECT #18297). TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		4
H505	OFFICE	VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
H505A	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H505K	CORRIDOR	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H506	OFFICE	NEW DRYWALL CEILING								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building component.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected



Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H507	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL									REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H507A	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H508	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H509S	STAIRWELL	CEILING TILE	1'X1' LENGTH WISE FISSURE FITTINGS	CEILING SPACE STAIRWELL		R-SA11		ND		NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		MECHANICAL SYSTEMS INSULATION								YES		FRIABLE	REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H509V	VESTIBULE	NEW LAY-IN CEILING TILES								NO			NOT SUSPECTED TO CONTAIN ASBESTOS		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H510	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H511	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H512	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H513	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H514	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H515	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H516	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H517	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	WITHIN RADIATOR UNITS AT PERIMETER WALL							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H518	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H519	OFFICE	BLACK MASTIC	NEW - 2020							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H520	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H521	OFFICE	VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	WITHIN RADIATOR UNITS AT PERIMETER WALL							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
H522	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		VINYL SHEET FLOORING BLACK MASTIC	NEW - 2020 FLOOR MASTIC							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	WITHIN RADIATOR UNITS AT PERIMETER WALL							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 - Perform asbestos removal/repair for compliance with the regulations.  
3 - Type 2 asbestos procedures required to enter area.  
4 - Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A - Not applicable.

**Definitions**  
ACM - Asbestos-Containing Materials  
SA - Sample representative  
R-SA - Sample referenced to a visually similar homogeneous sample material.  
ND - None detected



Historic Asbestos-Containing Materials Data  
University of Toronto Scarborough  
Humanities Wing

Room Number	Area #	Material	Description	Location	Qty/Unit	SA#	%	Type	Condition	ACM (Yes, No, Suspect)	Accessibility	Friability	Comments	Photographs	Action Required
H523	OFFICE	VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H524	OFFICE	VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H525A	MEETING ROOM	REFER TO H525C													
H525C	MEETING ROOM	VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
H525V	VESTIBULE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	WITHIN RADIATOR UNITS AT PERIMETER WALL							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H525S	STAIRWELL	MECHANICAL SYSTEMS INSULATION	FITTINGS	STAIRWELL						YES		FRIABLE	REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		MECHANICAL SYSTEMS INSULATION	FITTINGS	STAIRWELL						YES		FRIABLE	REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H526	OFFICE	VINYL SHEET FLOORING	NEW - 2020							NO					N/A
		BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
H527	OFFICE	ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		MASTIC	BROWN WALL MASTIC							NO					N/A
		VINYL SHEET FLOORING	NEW - 2020							NO					N/A
H527K	SOUTH END CORRIDOR	BLACK MASTIC	FLOOR MASTIC										REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		CAULKING	GREY CAULKING	EXPANSION JOINT	UNKNOWN	18274 S01		ND		NO			SAMPLED BY MAPLE (PROJECT #18274) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		CAULKING	YELLOW CAULKING	EXPANSION JOINT	UNKNOWN	18274 S02		ND		NO			SAMPLED BY MAPLE (PROJECT #18274) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
		FIBROUS MATERIAL	BROWN FIBROUS MATERIAL	EXPANSION JOINT	UNKNOWN	18274 S03		ND		NO			SAMPLED BY MAPLE (PROJECT #18274) IN 2019. TO VIEW PROJECT-SPECIFIC REPORT, SEE FACILITIES AND/OR HEALTH AND SAFETY.		N/A
H528	OFFICE	DRYWALL	NEW - 2020							NO			NEW - 2020		N/A
		ASBESTOS CEMENT BOARD	TRANSITE ASBESTOS CEMENT PANELS	WITHIN RADIATOR UNITS AT THE PERIMETER WALL						NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		PARGING CEMENT INSULATION ON MECHANICAL PIPE FITTINGS	WITHIN RADIATOR UNITS AT PERIMETER WALL							NO			REMOVED 2020 (MAPLE PROJECT #18297).		N/A
		DRYWALL	NEW - 2020							NO					N/A
		VINYL SHEET FLOORING	NEW - 2020							NO			NEW - 2020		N/A

**Level of Accessibility**  
A - Accessible and exposed to all occupants of the building.  
B - Accessible only to maintenance staff and exposed to view without moving a building compound.  
C - Accessible only to maintenance staff and concealed from view due to a building component.

**Level of Action Required**  
1 – Immediate clean-up of fallen ACM/debris likely to be disturbed.  
2 – Perform asbestos removal/repair for compliance with the regulations.  
3 – Type 2 asbestos procedures required to enter area.  
4 – Regular inspection/surveillance of ACM for compliance with the regulations.  
N/A – Not applicable.

**Definitions**  
ACM – Asbestos-Containing Materials  
SA – Sample representative  
R-SA – Sample referenced to a visually similar homogeneous sample material.  
ND – None detected