



Historic Asbestos Containing Materials Data
University of Toronto Scarborough
Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
PHASE 1 RESIDENCE BUILDINGS															
ASPEN HALL															
A1	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTOTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	SECOND FLOOR LANDING	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT	P1-1a (2010 Report)	1.5	CHRYSTOTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	<1 SQ. FT	P1-1a (2010 Report)	1.5	CHRYSTOTILE	YES	FAIR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility




- A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

- 1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

- ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A2	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3490 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED	WALL	6 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL ADJACENT TO KITCHEN TABLE	4 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
			DAMAGED DRYWALL	CEILING	2 SQ.FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	FAIR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

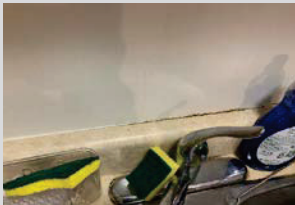

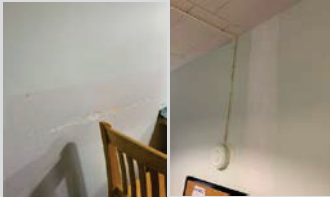

A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A4	KITCHEN	DRYWALL JOINT COMPOUND	MOULD IMPACTED	ABOVE KITCHEN SINK	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
A3	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	SHOWER ROOM	DRYWALL JOINT COMPOUND	WATER DAMAGED	WALL ADJACENT TO BATHTUB	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REMOVED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	CRACKED DRYWALL	WALL	6 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	4 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility



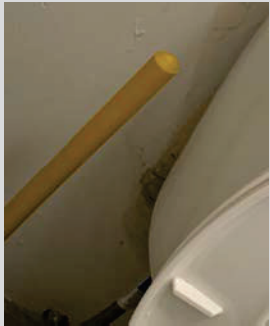
A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A4	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
A5	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3498 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REMOVED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL BEHIND TOILET	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REMOVED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.


Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A5	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	ENTRANCE	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	ENTRANCE VESTIBULE ADJACENT TO THE FIRE EXTINGUISHER - WALL	2 SQ. FT	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
A6	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3496 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED	WALL	10 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility



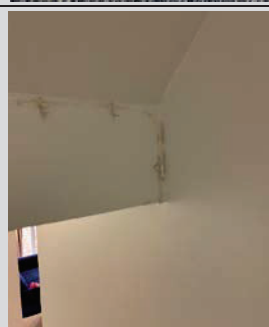
A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A7	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	WATER DAMAGED AND MOULD IMPACTED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	SECOND FLOOR LANDING	DRYWALL JOINT COMPOUND	DAMAGED CEILING BULKHEAD	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2

Level of Accessibility



A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A7	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED	WALL	50 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
A8	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3497 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	<1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2

Level of Accessibility


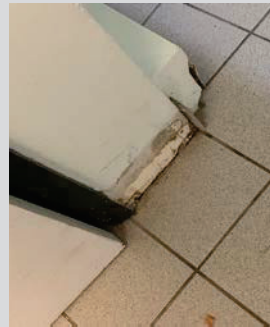

A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A9	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3499 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL BULKHEAD	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

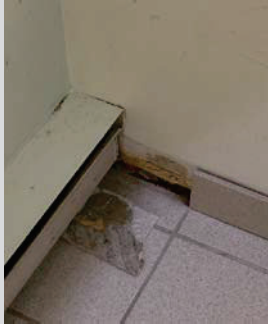


Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A9	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL NEAR FLOOR	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR BATHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL NEAR FLOOR	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
A10	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED AND MOULD IMPACTED DRYWALL	ADJACENT TO HOT WATER TANK	11 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.



Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Historic Asbestos Containing Materials Data

University of Toronto Scarborough

Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
A10	GROUND FLOOR CLOSET	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)		CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
A11	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
 B - Accessible only to maintenance staff and exposed to view without moving a building component.
 C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
 2 - Perform asbestos removal/repair for compliance with the regulations.
 3 - Type 2 asbestos procedures required to enter area.
 4 - Regular inspection/surveillance of ACM for compliance with the regulations.
 N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
 SA - Sample representative
 R-SA - Sample referenced to a visually similar homogeneous sample material.
 ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
BIRCH HALL															
B1	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3490 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED AND MOULD IMPACTED WALL	WALL	7 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	FRONT ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	<1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.


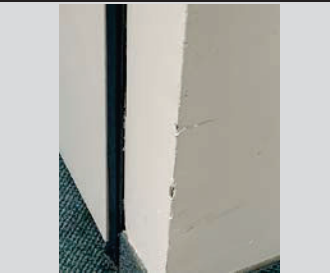
Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
B2	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	SECOND FLOOR LANDING	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	CEILING	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility


A - Accessible and exposed to all occupants of the building.
 B - Accessible only to maintenance staff and exposed to view without moving a building component.
 C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
 2 - Perform asbestos removal/repair for compliance with the regulations.
 3 - Type 2 asbestos procedures required to enter area.
 4 - Regular inspection/surveillance of ACM for compliance with the regulations.
 N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
 SA - Sample representative
 R-SA - Sample referenced to a visually similar homogeneous sample material.
 ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
B3	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	SECOND FLOOR BATHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL NEAR FLOOR	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
B4	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

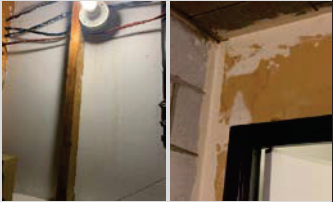


A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
B5	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3498 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR CEILING	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	CEILING	5 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

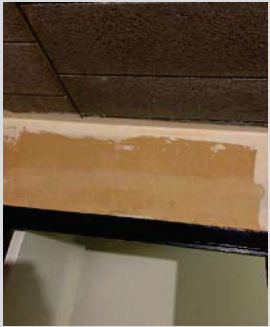
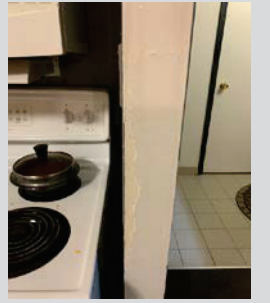

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
B6	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3495 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL EDGE	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	MONITOR FOR MOULD GROWTH		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	DRYWALL EDGE	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.




Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
B7	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	WASHROOM - SECOND FLOOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.



Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
B8	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3499 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	FRONT ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	4 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	BATHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	CEILING	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility


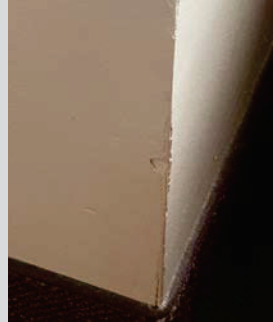
A - Accessible and exposed to all occupants of the building.
 B - Accessible only to maintenance staff and exposed to view without moving a building component.
 C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
 2 - Perform asbestos removal/repair for compliance with the regulations.
 3 - Type 2 asbestos procedures required to enter area.
 4 - Regular inspection/surveillance of ACM for compliance with the regulations.
 N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
 SA - Sample representative
 R-SA - Sample referenced to a visually similar homogeneous sample material.
 ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
CEDAR HALL															
C1	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

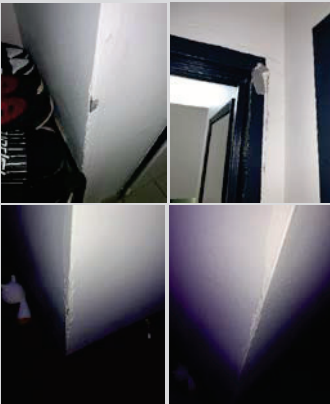


A - Accessible and exposed to all occupants of the building.
 B - Accessible only to maintenance staff and exposed to view without moving a building component.
 C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
 2 - Perform asbestos removal/repair for compliance with the regulations.
 3 - Type 2 asbestos procedures required to enter area.
 4 - Regular inspection/surveillance of ACM for compliance with the regulations.
 N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
 SA - Sample representative
 R-SA - Sample referenced to a visually similar homogeneous sample material.
 ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C1	ROOM C-1-H	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	5 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
C2	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3485 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.




Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C2	THIRD FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
C3	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED AND MOULD IMPACTED DRYWALL	WALL	8 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	FRONT ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.




Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C3	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR BATHROOM	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility



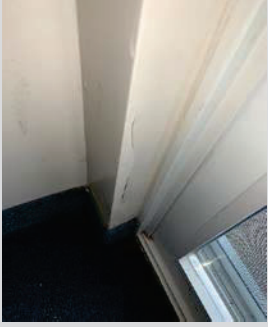
A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C4	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3496 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYBOTILE	YES	GOOD	A	NON-FRIABLE			4
	FRONT ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYBOTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYBOTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYBOTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.




Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C5	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3475 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR BATHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL NEAR FLOOR	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C6	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED	WALL	25 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2

Level of Accessibility


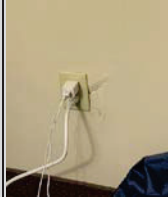

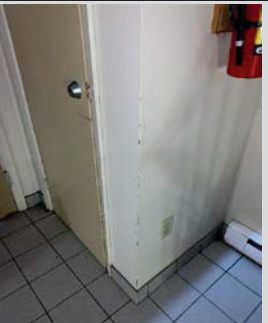
A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C6	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	ROOM C-6-F	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT + 1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	DRYWALL EDGE	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	GROUND FLOOR CLOSET	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C6	STAIRWELL	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL - 3RD FLOOR	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
C7	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	DRYWALL EDGE	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	MOULD IMPACTED	ABOVE KITCHEN SINK	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO	GOOD	A	NON-FRIABLE			N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions


ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Historic Asbestos Containing Materials Data
University of Toronto Scarborough
Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
C8	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3495 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL - 2ND FLOOR	1 SQ. FT. + 3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building compour2
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
DOGWOOD HALL															
D1	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3496 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	FRONT ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative



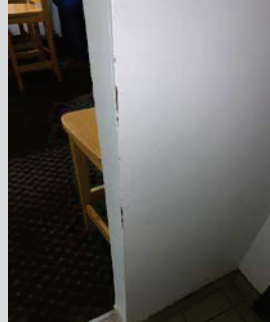
R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Historic Asbestos Containing Materials Data

University of Toronto Scarborough

Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D1	SECOND FLOOR BATHROOM	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
D2	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3497 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	4 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.



Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D2	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3495 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D3	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL NEAR FLOOR	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility



A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D3	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	4 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D4	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	4 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	FRONT ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	5 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.



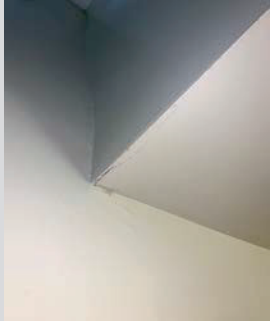
Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D4	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	CEILING BULKHEAD	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

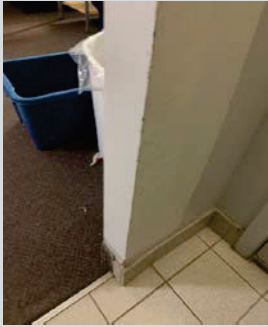
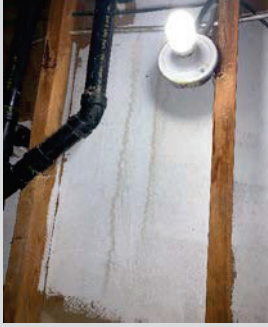

A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D5	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	10 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED	WALL	20 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D5	SECOND FLOOR BATHROOM	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility



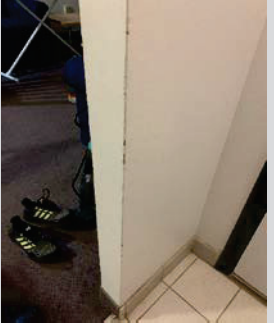
A - Accessible and exposed to all occupants of the building.
 B - Accessible only to maintenance staff and exposed to view without moving a building component.
 C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
 2 - Perform asbestos removal/repair for compliance with the regulations.
 3 - Type 2 asbestos procedures required to enter area.
 4 - Regular inspection/surveillance of ACM for compliance with the regulations.
 N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
 SA - Sample representative
 R-SA - Sample referenced to a visually similar homogeneous sample material.
 ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D5	THIRD FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
D6	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	4 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

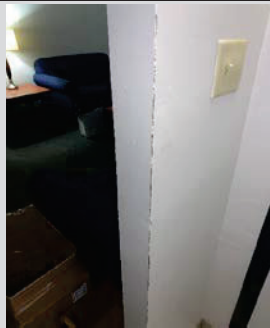


Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D7	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED EDGING	WALL	12 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL NEAR SINK	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	4 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

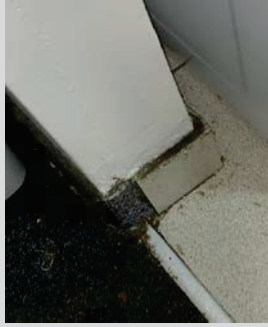


A - Accessible and exposed to all occupants of the building.
 B - Accessible only to maintenance staff and exposed to view without moving a building component.
 C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
 2 - Perform asbestos removal/repair for compliance with the regulations.
 3 - Type 2 asbestos procedures required to enter area.
 4 - Regular inspection/surveillance of ACM for compliance with the regulations.
 N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
 SA - Sample representative
 R-SA - Sample referenced to a visually similar homogeneous sample material.
 ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D7	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL NEAR FLOOR	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.




Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D8	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED EDGING	WALL	12 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.


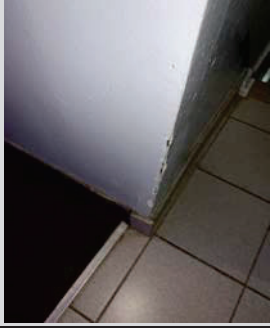
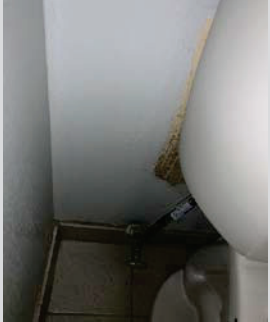
Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D9	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	FRONT ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility


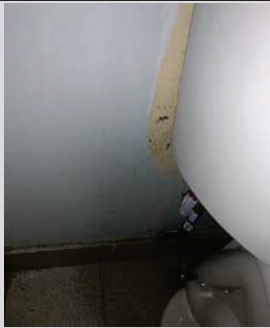
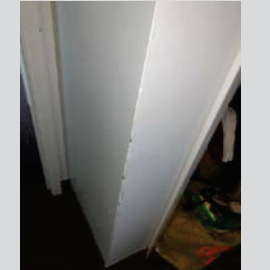
A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
D9	ROOM D-9-F	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	BEDROOM D-9-I	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	< 1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility


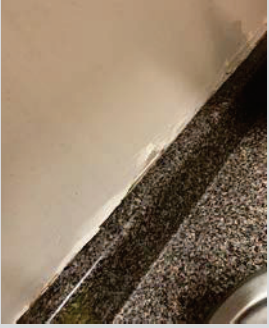

A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
ELM HALL															
E1	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED DRYWALL	WALL	10 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	KITCHEN	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.


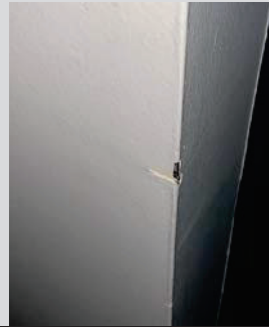

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E1	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
E2	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	4 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility



A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E2	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED	WALL	6 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility



A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building compou
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E3	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3490 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED EDGING	WALL	5 L.FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED	WALL	10 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E4	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED	WALL	20 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED EDGING	WALL	2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR BATHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility

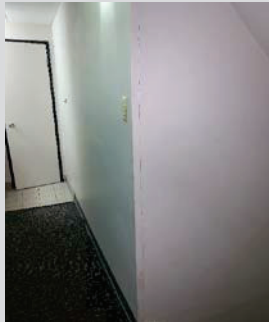


A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E4	SECOND FLOOR CORRIDOR	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	5 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
E5	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3497 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER STAINED	WALL	42 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 2 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2
	KITCHEN	DRYWALL JOINT COMPOUND	MOULD IMPACTED	ABOVE KITCHEN SINK	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.




Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E5	SECOND FLOOR WASHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	CEILING	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	ENTRANCE	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	3 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
E6	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	BASEMENT	DRYWALL JOINT COMPOUND	WATER DAMAGED AND MOULD IMPACTED DRYWALL	WALL	4 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05 IN CONJUNCTION WITH EACC LEVEL 1 MOULD PROCEDURES.		2

Level of Accessibility



A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E6	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	5 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility




A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E7	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR BATHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	3 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THIRD FLOOR BATHROOM	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.



Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E8	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3494 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
E9	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	GOOD	A	NON-FRIABLE			4
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	LIVING ROOM + KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL EDGE	1 SQ. FT + 2 L. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	KITCHEN	DRYWALL JOINT COMPOUND	WATER DAMAGED DRYWALL	WALL	2 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2

Level of Accessibility


A - Accessible and exposed to all occupants of the building.
B - Accessible only to maintenance staff and exposed to view without moving a building component.
C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.
2 - Perform asbestos removal/repair for compliance with the regulations.
3 - Type 2 asbestos procedures required to enter area.
4 - Regular inspection/surveillance of ACM for compliance with the regulations.
N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials
SA - Sample representative
R-SA - Sample referenced to a visually similar homogeneous sample material.
ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
E9	KITCHEN	DRYWALL JOINT COMPOUND	DAMAGED DRYWALL	WALL	1 SQ. FT.	P1-1a (2010 Report)	1.5	CHRYSTILE	YES	POOR	A	NON-FRIABLE	THE DAMAGED DRYWALL WITH ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND SHOULD BE REPAIRED FOLLOWING TYPE 1 ASBESTOS PROCEDURES, AS PRESCRIBED UNDER O. REG. 278/05.		2
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
PHASE 2 RESIDENCE BUILDINGS															
FIR HALL															
ALL	THROUGHOUT	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	THROUGHOUT BUILDING	UNKNOWN	02 (A-C) (2013 REASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4
F1	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	GROUND FLOOR - ENTRANCE CORRIDOR	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	SMALL CLOSET	6 SQ. FT.	02 (A-C) (2013 RE-ASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Historic Asbestos Containing Materials Data

University of Toronto Scarborough

Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
F2	THROUGHOUT	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	THROUGHOUT BUILDING	UNKNOWN	02 (A-C) (2013 REASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4
	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
F3	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
F4	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
	GROUND FLOOR - ENTRANCE CORRIDOR	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	SMALL CLOSET	6 SQ. FT.	02 (A-C) (2013 RE-ASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
F5	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
F6	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	GROUND FLOOR - ENTRANCE CORRIDOR	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	SMALL CLOSET	2 SQ. FT.	02 (A-C) (2013 RE-ASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	NOT OBSERVED DURING 2020 REASSESSMENT		4
F7	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
F7	GROUND FLOOR - ENTRANCE CORRIDOR	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	SMALL CLOSET	6 SQ. FT.	02 (A-C) (2013 RE-ASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
F8	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
F9	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
F10	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
F11	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
	GROUND FLOOR - ENTRANCE CORRIDOR	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	SMALL CLOSET	6 SQ. FT.	02 (A-C) (2013 RE-ASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

**Historic Asbestos Containing Materials Data
University of Toronto Scarborough
Phase 1 and Phase 2 Residences**

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
GREY PINE HALL															
ALL	THROUGHOUT	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	THROUGHOUT BUILDING	UNKNOWN	02 (A-C) (2013 REASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4
G1	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
G2	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Historic Asbestos Containing Materials Data

University of Toronto Scarborough

Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
G3	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSOTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
G4	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSOTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
G5	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSOTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
G6	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSOTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Historic Asbestos Containing Materials Data

University of Toronto Scarborough

Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
G7	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
G8	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
G9	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

**Historic Asbestos Containing Materials Data
University of Toronto Scarborough
Phase 1 and Phase 2 Residences**

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
HICKORY HALL															
ALL	THROUGHOUT	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	THROUGHOUT BUILDING	UNKNOWN	02 (A-C) (2013 REASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4
H1	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H2	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H3	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Historic Asbestos Containing Materials Data University of Toronto Scarborough Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
H4	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H5	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H6	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H7	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H8	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

**Historic Asbestos Containing Materials Data
University of Toronto Scarborough
Phase 1 and Phase 2 Residences**

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
H8	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H9	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
H10	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
IRONWOOD HALL															
ALL	THROUGHOUT	VINYL FLOOR TILES WITH YELLOW MASTIC	12"X12" TAN VINYL FLOOR TILES WITH BROWN STREAKS AND YELLOW MASTIC	THROUGHOUT BUILDING	UNKNOWN	02 (A-C) (2013 REASSESSMENT)	1.0-1.2	CHRYSTILE	YES	GOOD	A	NON-FRIABLE	THE MASTIC WAS ALSO ANALYZED AND DETERMINED TO BE NON-ASBESTOS. THESE TILES MAY BE PRESENT IN OTHER PHASE 2 RESIDENCE BUILDINGS IN CONCEALED AREAS (I.E., BENEATH CARPETS AND NEWER FLOORING LAYERS).		4
I1	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected

Historic Asbestos Containing Materials Data

University of Toronto Scarborough

Phase 1 and Phase 2 Residences

Unit#	Area	Material	Description	Location	Qty/Unit	Sample Number	%	Type	ACM (Yes, No, Suspect)	Condition	Accessibility	Friability	Comments	Photograph of Damaged ACM	Action Required
12	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
13	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
14	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
15	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A
16	EXTERIOR	CAULKING	BROWN CAULKING	EXTERIOR WINDOWS, DOORS & TRIM	45 L.FT.	P2-3(A-C) (2010 Report)	0.25	CHRYSTILE	NO				TRACE ASBESTOS DETECTED. MATERIAL NOT CONSIDERED TO BE ASBESTOS-CONTAINING.		N/A
	INTERIOR - WINDOWS AND DOORS	PERIMETER CAULKING	VARIOUS CAULKING APPLICATIONS - INTERIOR	PERIMETER OF WINDOWS AND DOORS - INTERIOR	45 L.FT.	P2-2(A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	LIGHT FIXTURE	HEAT SHIELD PAPER	THROUGHOUT BUILDING	UNKNOWN	NOT SAMPLED	N/A	PRESUMED	PRESUMED	GOOD	D	FRIABLE	PRESUMED ACM, NOT PREVIOUSLY SAMPLED		4
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	3500 SQ. FT.	P1-2 (A-C) (2010 Report)		ND	NO						N/A
	THROUGHOUT	DRYWALL JOINT COMPOUND	WHITE DRYWALL JOINT COMPOUND	WALLS AND CEILINGS	SEE ABOVE	01 (A-D) (2013 ACM RE-ASSESSMENT)		ND	NO						N/A

Level of Accessibility

A - Accessible and exposed to all occupants of the building.

B - Accessible only to maintenance staff and exposed to view without moving a building component.

C - Accessible only to maintenance staff and concealed from view due to a building component.

Level of Action Required

1 - Immediate clean-up of fallen ACM/debris likely to be disturbed.

2 - Perform asbestos removal/repair for compliance with the regulations.

3 - Type 2 asbestos procedures required to enter area.

4 - Regular inspection/surveillance of ACM for compliance with the regulations.

N/A - Not applicable.

Definitions

ACM - Asbestos-Containing Materials

SA - Sample representative

R-SA - Sample referenced to a visually similar homogeneous sample material.

ND - None detected